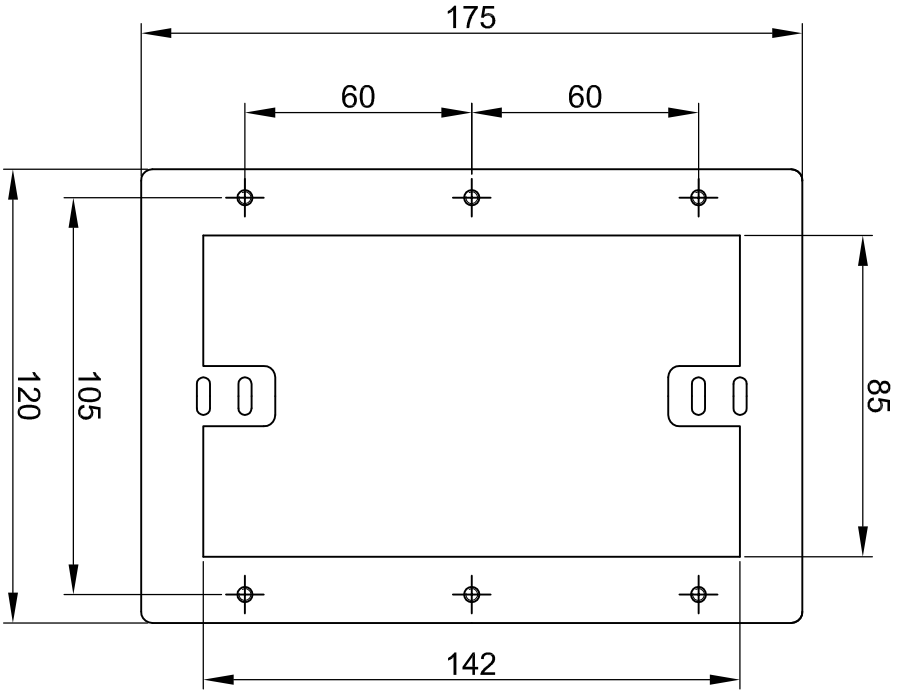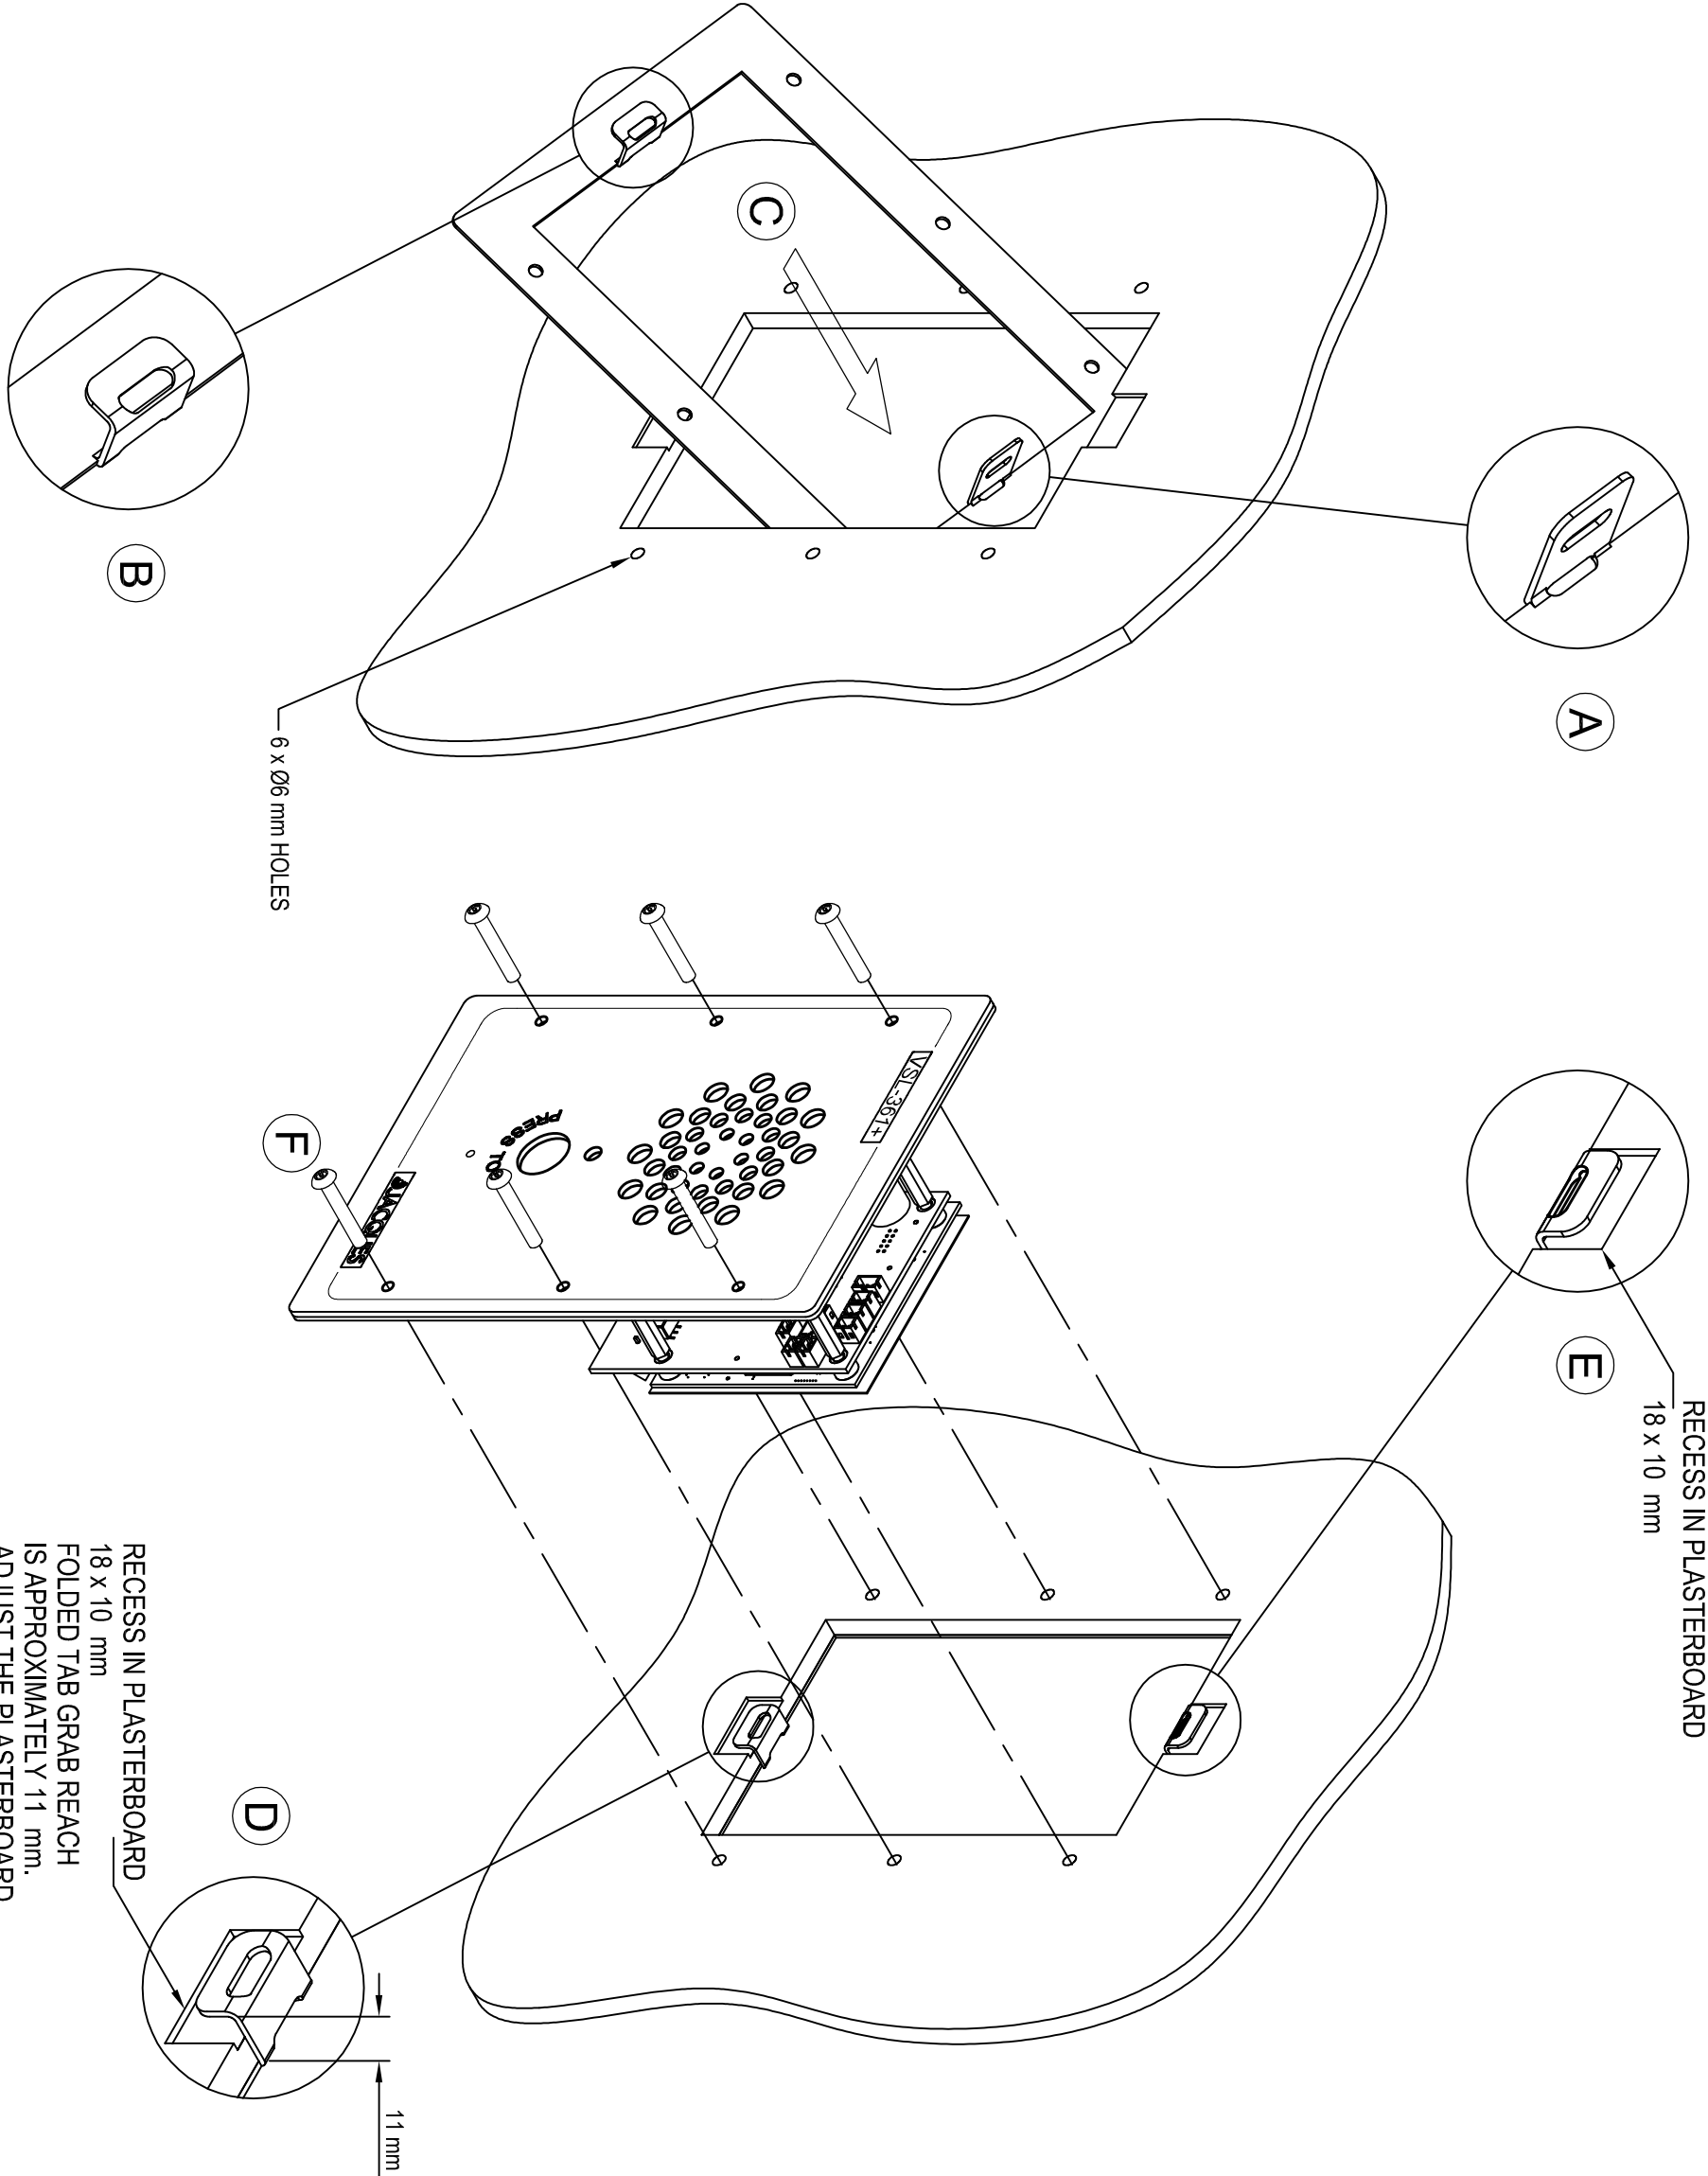DO NOT SCALE
IF IN DOUBT - ASK!

INSTALLATION OF VSL-x6x INTERCOMS USING PWB-4 (51812)
PLASTERBOARD WALL MOUNTING BRACKET

WALL BRACKET
(FOR PLASTERBOARD
WALL MOUNTING)

MODEL : PWB-4
PART No : 51812

175
60
60
85
120
105
142

6 x Ø6 mm HOLES

A

B

C

RECESS IN PLASTERBOARD
18 x 10 mm

E

D

F

RECESS IN PLASTERBOARD
18 x 10 mm
FOLDED TAB GRAB REACH
IS APPROXIMATELY 11 mm.
ADJUST THE PLASTERBOARD
RECESS DEPTH TO SUIT.

11 mm

INSTALLATION INSTRUCTIONS

1. USE PLASTERBOARD BRACKET AS MARKING GUIDE
FOR WALL CUTOUT SIZE AND 6 FIXING HOLE POSITIONS
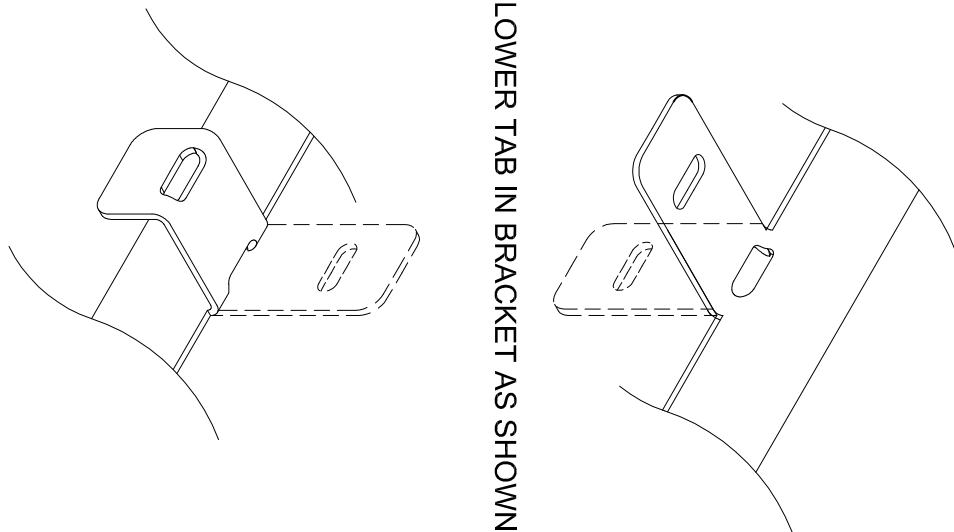IN WALL.

2. BEND THE UPPER TAB IN BRACKET AS SHOWN. Ⓐ

3. BEND THE LOWER TAB IN BRACKET AS SHOWN. Ⓑ

4. INSERT WALL BRACKET THROUGH CUTOUT AT ANGLE SHOWN,
ROTATE BRACKET TO VERTICAL POSITION UP AGAINST BACK OF
PLASTER BOARD WALL. Ⓒ

5. HOOK LOWER TAB OVER EDGE OF CUTOUT AS SHOWN. Ⓓ

6. FOLD UPPER TAB OVER CUTOUT EDGE AS SHOWN. Ⓔ

7. FIT UNIT WITH 6 M4 x 30 mm S/S SECURITY SCREWS. Ⓕ

JACQUES
Future Proof Communications

268 Montague Rd., West End, 4101, Australia
Ph: +617 3846 8400 Fax: +617 3844 1078
www.jacques.com.au
info@jacques.com.au

PWB-4 INSTALLATION DETAILS

REV	DATE	CHANGE DESCRIPTION		BY
0	2015-08-03	FIRST RELEASE		LFB

DRAWN: LFB DATE: 2015-08-03
CHECKED: DATE:
APPROVED: DATE:

ADAPTED FROM: N/A
FILENAME: 51812-INS.dwg
SCALE: N.T.S.
SHEET: 1 of 1
SIZE: A2

DWG NO: 51812-INS
REV: 0